# Ez One Shoť

# BARCODE Scanner User's Manual

# DEFAULT

Version:2009



Please power down the host computer before connecting this wand. This is critical to protecting both the wand and the host from serious damage

# Federal Communication Commission Interference Statement

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation.

This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one of the following measures:

- · Reorient or relocate the receiving antenna.
- · Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- · Consult the dealer or an experienced radio/TV technician for help.

FCC Caution: To assure continued compliance, any changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate this equipment. (Example - use only shielded interface cables when connecting to computer or peripheral devices).

#### FCC Radiation Exposure Statement

This equipment complies with FCC RF radiation exposure limits set forth for an uncontrolled environment. This equipment should be installed and operated with a minimum distance of 20 centimeters between the radiator and your body.

This transmitter must not be co-located or operating in conjunction with any other antenna or transmitter.

The antennas used for this transmitter must be installed to provide a separation distance of at least 20 cm from all persons and must not be co-located or operating in conjunction with any other antenna or transmitter.

This device complies with Part 15 of the FCC Rules. Operation is subject to the following two conditions:

(1) This device may not cause harmful interference, and (2) This device must accept any interference received, including interference that may cause undesired operation.

# CONTENTS

### GENERAL

Table of contents	1
Introduction, Ez Troubleshooting	2-3
Cloning Mode	
Getting Started	
How to fix the scanner to the terminal.	6-9
How to change a cable	9
How to set up the parameter	10

#### **SETTING GROUP(GROUP1~14)**

١		
	1 Interfaces selection, Computer type, Default	
	Scan speed 2 Reading Mode	
	3 Check Version, Beep tone, Terminator	
	Send Data Length	13
	4 Preamble and postamble	14
	5 Accuracy adjustment	15
	6 Enable and Disable Code ID,Label Type	10
	Positive/Negative 7 Symbologies Code Identifier	16
	8~9 Set Code ID, Customer Configuration	
	10 Delay between block and character	
	11 Keyboard layout, Caplock Mode, Numeric Key	
	12 RS232:Baud rate, Data bits & parity	22
	13 RS232:Stop bit, handshaking, ACK/NAK,	
	Flow Control, BCC	23
	14 Wand Emulation parameter setting	24
(	SYMBOLOGY FORMATTING(GROUP15~33	
	15 Enable Barcode Symbology	26
	16 Disable Barcode Symbology	
	17 China postcode(Toshiba code)	
	18 MSI code,UK Plessy code 19 Code93, Telepen, IATA	30
	20 Interleaved 2 of 5, Code 11	
	21 Industrial 2 to 5, Matrix 2 to 5	36
	22 Codabar	38
	23 ABC Codabar, CX Codabar	
	24 Codabar Coupling	
	25 Code 39 (Full ASCII/STANDARD), Code 32	
	26 UPC-E(0)&(1), UPC-E Expand to UPC-A	
	27 UPC-E	
	29 EAN-8	
	30 EAN-13,ISSN, ISBN, ISMN	
	31 EAN/UCC-128, CODE 128, PDF417	
	32 DataBar (RSS), Limited, Expand	
	33 Wirelss Model	51
	FULL ASCII(CODE39)TABLE FUNCTION	

#### CODE TABLE(GROUP34~48)

34~42 Full ASCII table(Code 39)	2-60
43~45 Function code table(Code 39) for PC-AT 6	
46~48 Trouble Shooting	4-66

#### APPENDIX

Appendix 1 Default table	67-69
Appendix 2 Cable pin Assignment	70-71
Appendix 3 Barcode test chart	72-73
Appendix 4 PDF-417 Demo chart	74-81
Appendix 5 Auto Sensing Mode for Laser scanner.	82-84
Appendix 6 Auto Sensing Mode for CCD scanner.	85-87

# INTRODUCTION

This scanner apply with Ez one shot easy programming decoder, It is specially designed to deliver high-end bar code reading performance at the lowest possible price. The scanner utilizes exceptional decoding technology. One-time settings are easily made by scanning set-up bar codes in this handy user's manual. This bar code scanner uses CCD or optical diode technology which does not have moving part, provide ragged reliable quality, enables it suit for any harsh environment conditions. Furthermore, the LED illumination light source of scanner provides less harmful beam to human eyes, and more longer product lifetime.

The Ez One shot decoder are mainly apply to the following categories bar code scanner for your reference:

1. Short Range- The reading distance is about from contact to 100mm,

- 2. Mid Range- The reading distance is about from contact to180mm,
- 3. Long Range The reading distance is about from 5mm to 300mm,
- 4. Wand or Pen bar code scanner.
- 5. Scan Engine and Fixed Mount scanner .

Notes: ( Please contact your distributor for the detail model number.)

# GENERAL

This scanner has many settings that can be used to conform the unit to the requirements of a particular application. For most usages, however, the default settings programmed into the unit at the factory are appropriate. It is not recommended that the default settings be changed unless there is a specific need to alter the characteristics of the scanner's performance.



The scanner is easy to install and use. Many problems encountered can be attributed to a wrong setting that has been programmed into the scanner. Before troubleshooting the problem, try this:

- 1. Unplug the cable from the host computer.
- 2. Plug the cable back into the host computer.
- 3. Reset the scanner settings to DEFAULT (Group 1).



If these steps do not resolve the problem, please refer to the troubleshooting table on the next page. If this fails to correct the problem, please consult the troubleshooting section beginning on page 64~66 for further assistance.

			Figure 2
No	Kind of Troubles	Symptoms	Solutions
1	Computer Type ( Group 1)	Scanner seems to be performing as usual, but no data is being output.	<ol> <li>Unplug the cable from the host computer.</li> <li>Plug the cable back into the host computer.</li> <li>Set the scanner to the exact computer type immediately.</li> </ol>
2	Interfaces Selections ( Group 1)	The scanner does not scan when the trigger is depressed.	<ol> <li>Unplug the cable from the host computer.</li> <li>Plug the cable back into the host computer.</li> <li>Set the scanner to the correct interface. Thecable needs to match the interface.</li> </ol>
т	Setting Procedure have not completed (Setting Need Triple Shot scanning ) Group - 4,5,8,9, 17, 18, 19,20,22,23,25, 31	Most settings require only a single bar code , but a few need several different bar codes to be scanned in order to completely define a setting. They are: 1. Preamble, Postamble (Group 4)(page 14) 2. Accuracy Adjustment (Group 5)(page 14) 3. Customer D Configuration (Groups 8 and 9)(page 18-19) 4. MinMax Length (Groups 21) 5. ABC Codabar (Groups 22) 6. CX-Codabar (Groups 22 and 23) 8. CX-Codabar (Groups 22 and 23) 8. EAN 128 (Group 31)	<ol> <li>Follow the procedures for these settings at the appropriate pages.</li> <li>The scanner will beep three times for an incomplete setting.</li> <li>Scan RESET to try a setting again.</li> </ol>
4	Limitation of length of the bar code	The scanner is reading correctly, except for certain bar codes of a certain length	Reset the Min/Max setting for the bar code symbology affected.
2	RS232 Protocol Comunication setting problem	The scanner appears to be working in the RS-232 interface, but no data is output.	Ensure the correct RS-232 communication parameters have been set: Baud Rate, Handshaking, Stop Bits, Data Bits, andParity. These settings must be the same for both the scanner and the host.

# **CLONING MODE**

#### WHAT IS CLONING MODE?

CLONING duplicates a wand's settings in other wands. It can save time when a number of wands must be programmed to the same settings.

#### HOW SHOULD CLONING WORK?

- 1. Using this guide, make all the necessary settings for one wand.
- 2. Scan the CLONING MODE bar code shown below.
- When CLONING MODE is scanned, all setup parameters will be converted to alphanumeric characters and shown on the monitor.
- 4. Using a bar code printer, print out all the setup parameters as Code 39 bar code labels.
- Scan the printed labels sequentially with each wand to be programmed.



.A018\$( Cloning Mode on PC/AT) - you can clone the settings to a PC/AT regardless what kind of device has been chosen on the scanner

#### NOTES:

- 1. All cloning strings are upper case.
- 2. All cloning strings printed on labels should be the same as those on the monitor sequentially from first to last.
- 3. Cloning mode works in Word Note Pad only.
- 4. Never edit the data on the first row (.A017\$). It is an entry gate for cloning.
- The cloning string's length can be adjusted by combining multiple strings into one, or by breaking one string to multiple strings starting from the second row after "....". Length must be in sequences of four, such as 4,8,12,16,20 (MAX).
- 6. Be sure to print the dots exactly where they are shown on the monitor.

#### FORMAT OF CLONING

\* Format of Cloning :

1st rows >>> ".A017\$" ( never edit any data of the first row ) 2nd rows >>> "....XXXX" you can adjust the String's Length starting from the dots"...." forward. The length of the string should be in 4, 8,12,16 or 20 ( MAX) digits. 3rd rows~ so on >>> XXXX End rows- A dot "." Is an ending of cloning.

XXXX Stand for any String

#### EXAMPLE :

- 1. PROJECT ASSIGNMENTS
- 1.1. Beep tone: BEEP LOW -- HIGH . 1.2. Capslock Mode: CAPSLOCK ON (FIXED ). 1.3. Reading Mode: CONTINUOUS AUTO OFF.
- 2. SETTING PROCEDURE: 2.1. Scan BEEP LOW.--HIC 2.2. Scan CAPSLOCK ON
- Scan BEEP LOW.--HIGH (GROUP 3).(page13)
   Scan CAPSLOCK ON (FIXED).(GROUP 3).
   Scan CONTINUOUS AUTO OFF. (GROUP2).(page12)
- 3. All parameters will be converted to alphanumeric characters and shown on the monitor.



4. Print the results shown on the monitor as bar codes with a bar code printer. The bar codes should be in the Code 39 symbology.



5. Scan these labels with any of the wands that must be programmed with the same settings as the first wand. Be sure to scan from the first row to the second and so on sequentially, top to bottom.


#### CORRECT SETTING

.A017\$	
0604	
5A02	
5F04	

Δ 4 4 4 . (Dot) .A017\$ ....06045A02 5F04.

12 4+.( Dot)

#### WRONG SETTING

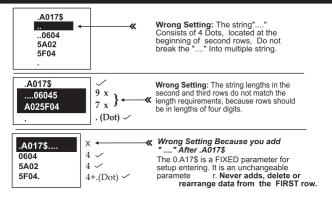

# **GETTING STARTED**

# HOW TO CONNECT THE WAND TO THE HOST COMPUTER

#### **KEYBOARD WEDGE INTERFACE**

- 1. Power down the host computer.
- 2. Disconnect the keyboard cable from the computer.
- 3. Connect the "Y" cable between the keyboard and the wand and the
- computer.
- Restart the computer.
   The wand will beep.
- 6 Set the wand to KEYBOARD interface by referring to GROUP 1 (page11) (Interface Selections).
- 7. Wand will beep to confirm the setting.
- 8. Scan a bar code to confirm that data shows on the monitor.



**USB INTERFACES** 


The USB Interface is compatible with the Apple MAC series, later PCs and Windows 98, 2000, Me, and XP.

- 1. Connect the USB cable between the scanner and the computer.
- 2. The scanner will beep.
- The Scanner will detect the USB driver automatically. (The first time the scanner is connected via the USB port, follow the appropriate instructions for the host computer.)
- Set the scanner to KEYBOARD/USB interface by referring to GROUP 1 (page11) (Interface Selections).
- 5. Scanner will beep to confirm the setting.
- 6. Scan a bar code to confirm that data shows on the monitor.



#### **RS-232 INTERFACE**

- 1.Power down the host computer.
- 2.Connect the RS-232 cable between the wand and the computer.
- 3. Connect the power adaptor to the cable.
- 4.Restart the computer.
- 5. Plug the power adaptor into a power outlet.
- 6. The wand will beep. 7. Set the wand to RS-232 interface by referring to GROUP 1 (page11) (Interface Selection).
- 8. Set RS-232 protocol: Baud Rate, Stop Bits, Handshaking, Data Bits, and Parity.
- 9. Scan a bar code to confirm that data shows on the monitor.

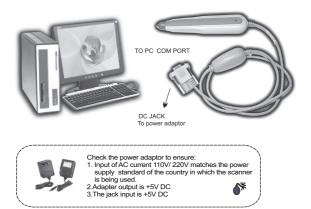

#### NOTES:


- 1. Before plugging the power adaptor into the wand, be sure the voltage, power consumption, and inner and outer DC characteristics are correct to avoid serious damage to the wand and/or the computer.
- 2. Make sure the protocol communication settings of the wand (such as baud rate, data bits, etc.) match those of the host computer. Otherwise, no data will be transmitted ...

7

#### HOW TO CONNECT THE SCANNER TO THE HOST TERMINAL: Handheld Barcode Scanner

#### **KEYBOARD WEDGE INTERFACE**

- 1. Power down the host computer.
- 2. Disconnect the keyboard cable from the computer.
- 3. Connect the "Y" cable between the keyboard and the scanner and the computer.
- 4. Restart the computer.
- 5. The scanner will beep.
- 6. Set the scanner to KEYBOARD interface by referring to GROUP 1 (page11) (Interface Selections).
- 7. Scanner will beep to confirm the setting.
- 8. Scan a bar code to confirm that data shows on the monitor.




#### **RS-232 INTERFACE**

- 1. Power down the host computer.
- 2.Connect the RS-232 cable between the scanner and the computer.
- 3 Connect the power adaptor to the cable.
- 4 Restart the computer,
- 5.Plug the power adaptor into a power outlet.
- 6.The scanner will beep.
- 7.Set the scanner to RS-232 interface by referring to GROUP 1 (page 11) (Interface Selection).
- Set RS-232 protocol: Baud Rate, Stop Bits, Handshaking, Data Bits, and Parity.
- 9.Scan a bar code to confirm that data shows on the monitor.

#### NOTES:

- Before plugging the power adaptor into the scanner, be sure the voltage, power consumption, and inner and outer DC characteristics are correct to avoid serious damage to the scanner and/or the computer.
- 2.Make sure the protocol communication settings of the scanner (such as baud rate, data bits, etc.) match those of the host computer. Otherwise, no data will be
- . transmitted ..

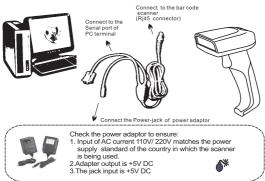

#### **USB INTERFACES**

The USB Interface supported is compatible with the Apple MAC series, later PCs and Windows 98, 2000, Me, and XP.

- 1. Connect the USB cable between the scanner and the computer.
- 2. The scanner will beep.
- The Scanner will detect the USB driver automatically. (The first time the scanner is connected via the USB port, follow the appropriate instructions for the host computer.)
- 4. Set the scanner to KEYBOARD/USB interface by referring to GROUP-1 (Interface Selections).
- 5. Scanner will beep to confirm the setting.
- 6. Scan a bar code to confirm that data shows on the monitor.




#### HOW TO CHANGE A CABLE

The CCD scanner are designed to switch easily between interface options. To switch from one interface to another, the appropriate cable must be installed. To change a cable, simply follow these steps:

- 1. To release the cable, insert a pin or straightened paper clip into the
- hole at the base of the scanner where the cable is connected.
- 2. Remove the cable from the scanner.
- 3. Plug in the new cable.

After changing to a new cable, be sure to resetthe interface setting as appropriate (including parameter settings for the RS-232 interface).

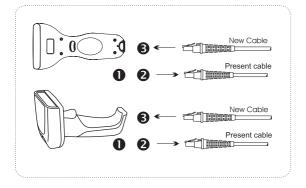


#### HOW TO SET PARAMETERS

# How do you program a scanner with this user's guide?

- 1. Use the scanner to scan at the bar code representing the function/ parameter you want to set.
- 2. When you hear two beeps, the new setting will have been defined or updated into the memory processor.

Default parameters are indicated in bold type and underlined characters. The character font is ARIAL BLACK. CD = Check Digit. CDV = Check Digit Verification.

Most settings require only a single bar code, but a few need several different bar codes to be scanned in order to completely define a setting. They are:





SETTING BAR CODE

#### Preamble / Postamble (maximum 16 digits)

Step 1: Scan CLR PRE/POSTAMBLE. Step 2: Scan PREAMBLE or POSTAMBLE.

Step 3: Scan any alphanumeric from Full ASCII Table in Groups 34 - 45. (page52-63) Step 4: Scan PREAMBLE or POSTAMBLE.

#### Min Length / Max Length

Step 1: Scan MIN LENGTH or MAX LENGTH. Step 2: Scan two digits from Group 42 (page60) Step 3: Scan MIN LENGTH or MAX LENGTH.

#### Accuracy Adjustment

Step1: Scan ACCURACY ADJUSTMENT. Step 2:Scan one digit from Group 42 (page60) Step 3:Scan ACCURACY ADJUSTMENT.

#### Customer Configuration ID (Example: Code 39) Step 1: Scan CODE 39 SET ID from Group 8. (page18)

Step 1: Scan CODE 39 SET ID from Group 8. (page18) Step 2: Scan either one digits or two digits alphanumeric (maximum 2 digits) from Full ASCII table In Groups 34 - 45. (page52-63) Step 3: Scan CODE 39 SET ID from Group 8. (page18)

#### Set A Data - ( CX-Codabar, ABC Codabar, Codabar Coupling). Step1: Scan SET A DATA.

Step 2:Scan one digits any alphanumeric character from Full ASCII Table in Groups 34 - 45. (page52-63) Step 3: Scan SET A DATA.

#### NOTES:

- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., scan RESET to start again.



INTERFACES SELECTION, COMPUTER TYPE, DEFAULT, SCAN SPEED.



SYMPTOMS	SOLUTION
performing as usual,	<ol> <li>Unplug the cable from the host computer.</li> <li>Plug the cable back into the host computer.</li> <li>Set the scanner to the exact computer type immediately.</li> </ol>

Caution:Please ensure the correct computer type is set when the scanner is attached to a new host computer. If set to Notebook, the scanner will operate with no external keyboard.



KEYBOARD& USB\*1, ₪



\*1 USB V1.3 or small Version

\*2 USB V2.2 or great Version

Contact /pen type use only

# **INTERFACES SELECTION**



RS232



USB\*2 ₪

SYMPTOM	SOLUTION
The wand does not scan/ The scanner does not scan when the trigger is depressed.	<ol> <li>Unplug the cable from the host computer.</li> <li>Plug the cable back into the host computer.</li> <li>Set the wand to the correct interface. The cable needs to match the interface.</li> </ol>

Caution: This scanner is designed to switch easily between interface options. To switch from one interface to another, the appropriate cable must be installed. After changing to a new cable, be sure to reset the interface setting as appropriate.





Contact /pen type use only

#### **READING MODE SETTING**




F001\$

FLASH MODE F002\$

F003\$

TOGGLE MODE

TRIGGER MODE



- \*The LED is on steadily if a bar code is close to the scanner, but starts to flash if no bar code has been detected after 60 seconds.
- \* This trigger is still have functionality.
- \* The LED will light when the trigger is pressed.
- \* The LED will go off when the trigger is released.



- \* The LED is always on when the trigger is
- \* The LED will go off if no bar code has been detected after 60 seconds.
- \* This function works like Trigger Mode, but the scanner beeps to indicate a good read.



\*AUTO SENSING MODE



**\*ULTRAVIOLET MODE** 



TEST MODE

- \* If Auto-Sensing (Triggerless) Mode is on, the LED will go off if the scanner does not detect a bar code.
- The LED lights automatically when a bar code is detected.
- \* If Ultraviolet Mode is on, the ultraviolet light source will light and stay on continuously.
- \* The ultraviolet light will go off when the trigger is pressed, and back on when the trigger is released.

\* Factory Test Scanning

#### NOTES:

- 1. To extend the scanner's life, keep the scanner set to Trigger Mode or Continuous Auto Off Mode.
- 2. Only certain models support Auto Sensing or Ultraviolet Modes.
- 3. For convenience, print the bar code for Ultraviolet Mode and keep it near the work station for easy scanning when needed.
- 4. In Ultraviolet Mode, press the trigger button and the reading mode will swift from Ultraviolet Mode to the reading mode the scanner was last in.
- 5. The LED will glow RED for STANDBY and GREEN for GOOD READ. 6. The Trigger Mode is available for most handheld bar code scanner, but

The trigger is only available to wands with a switch capability.

CHECK VERSION, BEEP TONE , TERMINATOR SEND DATA LENGTH









2.1KHz

F012\$





NOTES:

- 1. For the Keyboard Wedge interface the default terminator is CR.
- 2. For the USB interfaces the default terminator is CR,
- 3. For the RS232 interfaces the default terminator is CR+LF

13





SETUP CODE READ, PREAMBLE & POSTAMBLE.





#### NOTE :

\* 1 This setting is disable to all User's Manual Code setting. To use bar code setting, Scan Setup Code On enable bar code setting.

#### PREAMBLE & POSTAMBLE ( PREFIX AND SUFFIX )







POSTAMBLE (16)

#### EXAMPLE:

Set PREAMBLE String as " ## " POSTAMBLE String as " \$\$ "

#### SETTING PROCEDURE:


STEP 1 : Scan : CLEAR PRE/ POSTAMBLE. STEP 2 : Scan : PREAMBLE. STEP 3 : Scan : "#" twice from FULL ASCII Table. STEP 4 : Scan : PREAMBLE. STEP 5 : Scan : POSTAMBLE. STEP 6 : Scan : \$ " twice From FULL ASCII Table. STEP 7 : Scan : POSTAMBLE.

#### FORMAT:

{ Preamble}{CodeID}{Bar Code}{Postamble}

#### NOTES:

- 1. A PREAMBLE is a string of up to 16 characters added to the beginning of a scanned barcode.
- 2. A POSTAMBLE is a string of up to16 characters added to the end of a scanned bar code.
- 3. Default value for either: None.

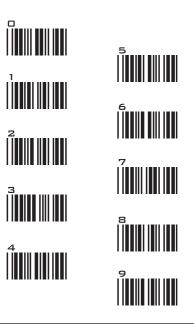

#### ACCURACY ADJUSTMENT



Accuracy Adjustment assures a more reliable decoded output. Enabling the feature and setting a number from 1 to 9 subjects the decoded output a higher standardof accuracy. The higher the number, the greater the accuracy.

SETTING PROCEDURE: 1. Scan ACCURACY ADJUSTMENT. 2. Scan one digit (1~9) from barcode menu above. 3. Scan ACCURACY ADJUSTMENT.



#### NOTES:

- 1. The scanner will beep three times as reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., scan RESET to start again.

15

LABEL TYPE POSITIVE / NEGATIVE, ENABLE AND DISABLE CODE ID

#### LABEL TYPE POSITIVE / NEGATIVE



(POSITIVE LABEL ENABLE)



(POSITIVE & NEGATIVE ENABLE)

Contact /pen type can't use





FACTORY ID ON





SET ID -ON

#### **DISABLE CODE ID**




#### NOTES:

- 1. Only ONE code ID will be sent.
- 2. The code ID is located at the position before the bar code data and after the preamble.

#### EXAMPLE :

1.Preamble 145287.

- 2.Code ID: enable AIM ID,
- 3.Bar code symbologies : EAN 13+5

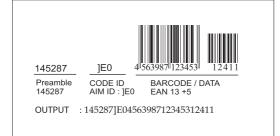

#### SYMBOLOGIES CODE ID IDENTIFIER, SET ID

SYMB	OLOG	SIES C	ODE ID IDENTIFIER		
Symbologies	Factory ID	AIM ID (new)	Symbologies	Factory ID	AIM ID (new)
MSI	0	]M0	EAN 128	Т	]C1
MSI(MOD 10 / CDV & not send CD)	Ŭ	]M1	Code 128	K	]C0
EAN8(+2/+5 OFF)		]E4	Code 32	В	]X0
EAN8(+2 ON)	s	]E4	Codabar		]F0
EAN8(+5 ON)		]E4	Codabar(ABC Codabar)	N	]F1
UPC-E(+2/+5 OFF)		]E0	Codabar(CDV & Send CD)		]F2
UPC-E(+2 ON)	Е	]E3	Codabar(CDV & not send CD)		]F4
UPC-E(+5 ON)		]E3	UK Plessey	Р	]P0
UPC-A(+2/+5 OFF)		1E0	Matrix 2 of 5	Y	]X0
UPC-A(+2 ON)	A	1E3	ASCII Code 39(disable CDV) Full		]A4
UPC-A(+5 ON)		1E3	ASCII Code 39(CDV & send CD)	D	]A5
EAN-13(+2/+5 OFF)		1E0	Full ASCII Code 39(CDV & not send CD)		]A7
EAN-13(+2 ON)	F	1E3	Standard Code 39(disable CDV)		]A0
EAN-13(+5 ON)	L î	1E3	Standard Code 39(CDV & send CD)	М	]A1
Code 93	L	]G0	Standard Code 39(CDV & not send CD)	-	]A3
	L	1H0	TA 2 of 5	R	]R0
Code 11(disable CDV)		1H0	Hittustrial 2 of 5	V	]S0
Code 11(send one CD) Code 11(send two CD)	J	,	China Post Code	Н	]X0
Code 11(send two CD) Code 11(not send CD)		]H1	Interleaved 2 of 5(CDV & send CD)		]11
		]H3	Interleaved 2 of 5(CDV & not send CD)	I	]13
Telepen(ASCII)	U	]B0	Interleaved 2 of 5(disable CDV)		]10
Telepen(Numeric)		]B1	Data Bar(Rss)	G	]E0

#### **SET ID - SETTING PROCEDURES**

Settting steps:

- 1. Scan the SET ID bar code for a particular symbology.
- 2. Scan one or two alphanumeric characters from the Full ASCII Table.
- 3. Scan the SET ID bar code again.

```
Example :Define the MSI Code ID = A, Code 93 = G9

MSI :

Step1: Scan MSI Set ID (Group 9). (page19)

Step2: "A" from Group 37. (page55)

Step3: Scan MSI Set ID (Group 9). (page19)

Code 93:

Step1: Scan Code 93 Set ID (Group 8). (page18)

Step2: "G" from Group 38, Scan "9" from Group 33..(page51)

Step3: Scan Code 93 Set ID (Group 8).(page18)
```

#### NOTES:

- The length of a Code ID is either one or two characters. If one character is set, the Code ID output will be one character. If two characters are set, the Code ID output will be two characters.
- 2. Only one type of Code ID will be sent.

CODE ID CONFIGURATION: SET ID

. Poo 1 \$	EAN 13 Set ID
. P002\$	EAN 8- Set ID
. Pocs#	UPC E Set ID
. P004\$	UPC A Set ID
. Poos#	CODE 39 Set ID
. Po 13\$	Code 93 Set ID
. P007\$	Codabar Set ID
. PO21\$	IATA Set ID
	Code 128 Set ID
. Po 1.6\$	EAN128 Set ID
. P022\$	Telepen Set ID
. P009\$	Code 11 Set ID
. PO 1 1 \$	Code 32 Set ID

#### CODE ID CONFIGURATION: SET ID

China Post Code [TOSHIBA Code ] Set ID

MSI Code Set ID

UK Plessy Set ID

Matrix 2 of 5 Set ID

Interleaved 2 of 5 Set ID

Industrial 2 of 5 Set ID

Full ASCII Code39 Set ID

**RSS 14/LIMITED** 

**RSS-Expand Set ID** 

RSS-14 Set ID

LABEL Code Set ID ( Reserved )


. Po12\$ . PO15\$ . Po17\$ . PO18\$ . PC19\$ P020\$ P024\$ P0209 






- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., scan RESET to start again.

DELAY BETWEEN BLOCKS AND CHARACTERS

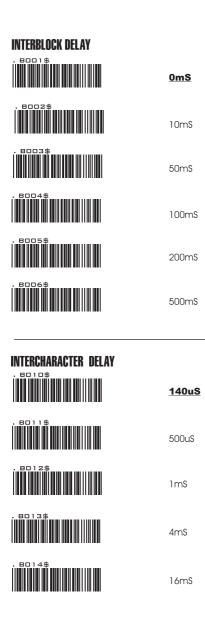

20

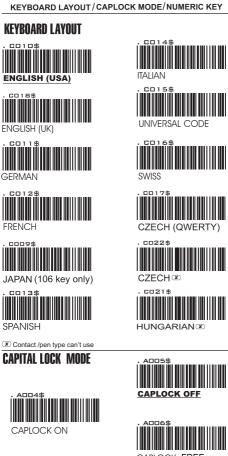

CAPLOCK FREE

#### NOTE:

 ①When Barcode scanner set to Caplock Free mode.No matter of keyboard CapsLock LED indicator is ON or OFF, output will be always the same as the Original barcode. In other words, what you see is what output is.(CODABAR is the exception.) ② If ABCD/ABCD, abcd/abcd, ABCD/T\*E, abcd/tn\*e are on, they work independently according to their rules.

21





ALPHANUMERIC KEY

Rs232: BAUD RATE, DATA BITS & PARITY








8 bits MARK



Rs232 : STOP BIT, HANDSHAKING, ACK/NAK, FLOW CONTROL, BCC

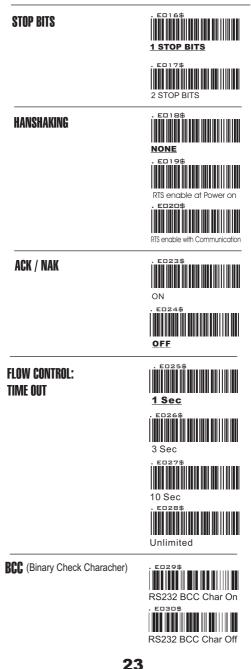



WAND EMULATION PARAMETER SETTING







**WAVE FORM** 


# **GROUP 15~ 33** SYMBOLOGIES FORMATTING

ENABLE SYMBOLOGIES





DISABLE SYMBOLOGIES

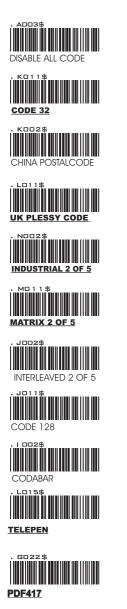

HDD2\$ UPC-A . HOOS\$ UPC-E ного\$ EAN-8 . HD14\$ FAN-13 . Looz\$ MSI GOO9\$ CODF 39 1011\$ CODE 11 GO 1 1 \$ CODE 93 MODZS EAN -128 ND18\$ ΙΑΤΑ

SYMBOLOGIES : CODE 32CHINA POST CODE ( TOSHIBA CODE ),

#### CHINA POSTAL CODE [ TOSHIBA CODE ]














MIN LENGTH (11)



# **APPENDIX**

FULL ASCII (Code 39) NUMERIC TABLE

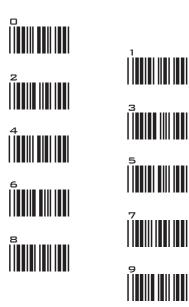

#### SETTING PROCEDURE

#### **MIN / MAX LENGTH**

STEP 1 - Scan: MIN LENGTH/ MAX LENGTH STEP 2 - Scan : Two digits from Appendix . STEP 3 - Scan: MIN LENGTH / MAX LENGTH

Please note that when Min Length and / or Max Length are enabled, the scanner will only read bar codes that fall into those length parameters. Bar codes shorter or longer than specified will not be read. The default lengths for these are indicated in parentheses under the Min and Max bar codes for each symbology.

#### NOTES:

- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., Scan RESET to start again.

29





SYMBOLOGIES : MSI CODE , UK PLESSY CODE



MOD 10

MSI





L005\$

MIN LENGTH ( 6 )








**UK PLESSY CODE** 





# **APPENDIX**

FULL ASCII (Code 39) NUMERIC TABLE

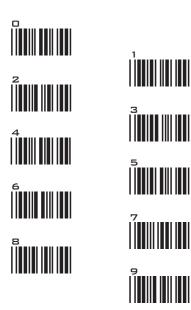

#### SETTING PROCEDURE

#### **MIN / MAX LENGTH**

STEP 1 - Scan: MIN LENGTH/ MAX LENGTH STEP 2 - Scan : Two digits from Appendix . STEP 3 - Scan: MIN LENGTH / MAX LENGTH

Please note that when Min Length and / or Max Length are enabled, the scanner will only read bar codes that fall into those length parameters. Bar codes shorter or longer than specified will not be read. The default lengths for these are indicated in parentheses under the Min and Max bar codes for each symbology.

#### NOTES:

- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., Scan RESET to start again.





SYMBOLOGIES: CODE 93, TELEPEN, IATA



DISABLE





MIN LENGTH (6)







#### **TFI FPFN**





TELEPEN NUMBER





DISABLE





IATA








# **APPENDIX**

FULL ASCII (Code 39) NUMERIC TABLE

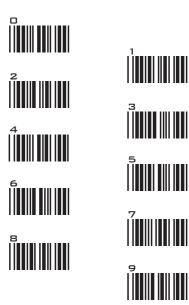

#### SETTING PROCEDURE

#### **MIN / MAX LENGTH**

STEP 1 - Scan: MIN LENGTH/ MAX LENGTH STEP 2 - Scan : Two digits from Appendix . STEP 3 - Scan: MIN LENGTH / MAX LENGTH

Please note that when Min Length and / or Max Length are enabled, the scanner will only read bar codes that fall into those length parameters. Bar codes shorter or longer than specified will not be read. The default lengths for these are indicated in parentheses under the Min and Max bar codes for each symbology.

#### NOTES:

- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., Scan RESET to start again.





SYMBOLOGIES : INTERLEAVED 2 OF 5 , CODE 11.













#### CODE 11










### APPENDIX

FULL ASCII (Code 39) NUMERIC TABLE

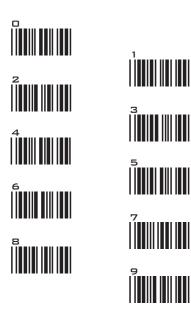

### SETTING PROCEDURE

#### **MIN / MAX LENGTH**

STEP 1 - Scan: MIN LENGTH/ MAX LENGTH STEP 2 - Scan : Two digits from Appendix . STEP 3 - Scan: MIN LENGTH / MAX LENGTH

Please note that when Min Length and / or Max Length are enabled, the scanner will only read bar codes that fall into those length parameters. Bar codes shorter or longer than specified will not be read. The default lengths for these are indicated in parentheses under the Min and Max bar codes for each symbology.

#### NOTES:

- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., Scan RESET to start again.





SYMBOLOGIES : INDUSTRIAL 2 OF 5, MATRIX 2 OF 5





CDV & NOT SEND CD



MAX LENGTH ( 48 )

. Mo 1 1 \$







### MATRIX 2 OF 5






MIN LENGTH ( 6 )



### **APPENDIX**

FULL ASCII (Code 39) NUMERIC TABLE

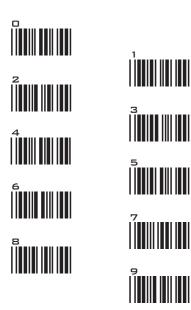

### SETTING PROCEDURE

#### **MIN / MAX LENGTH**

STEP 1 - Scan: MIN LENGTH/ MAX LENGTH STEP 2 - Scan : Two digits from Appendix . STEP 3 - Scan: MIN LENGTH / MAX LENGTH

Please note that when Min Length and / or Max Length are enabled, the scanner will only read bar codes that fall into those length parameters. Bar codes shorter or longer than specified will not be read. The default lengths for these are indicated in parentheses under the Min and Max bar codes for each symbology.

#### NOTES:


- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., Scan RESET to start again.

37





SYMBOLOGIES: CODABAR

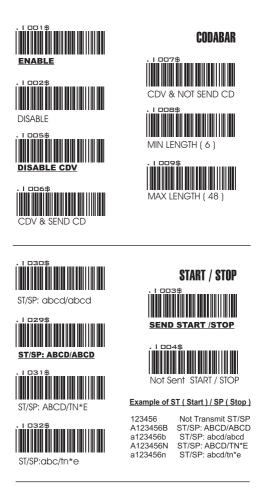



CLSI FORMAT OFF


### **CLSI FORMAT**

38

CLSI- Enable library space insertion. If you enable the CLSI format, this option inserts spaces in position 2,7,13of the datastring for use in library systems

### **APPENDIX**

FULL ASCII (Code 39) NUMERIC TABLE

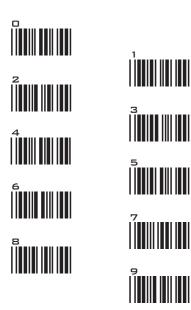

### SETTING PROCEDURE

#### **MIN / MAX LENGTH**

STEP 1 - Scan: MIN LENGTH/ MAX LENGTH STEP 2 - Scan : Two digits from Appendix . STEP 3 - Scan: MIN LENGTH / MAX LENGTH

Please note that when Min Length and / or Max Length are enabled, the scanner will only read bar codes that fall into those length parameters. Bar codes shorter or longer than specified will not be read. The default lengths for these are indicated in parentheses under the Min and Max bar codes for each symbology.


#### NOTES:

- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., Scan RESET to start again.





SYMBOLOGIES: ABC-CODABAR, CX- CODABAR



ABC- CODABAR





\* The data can any alphanumerics of FULL ASCII Table (GROUP 34-42)(page 52-60)

#### **REMARK:**

ABC-CODABAR (American Blood Commission.). The ABC Code is an acronym for American Blood Commission. This bar code is a variant of the CODABAR Code developed for he use in the blood bank. This Code consists of two bar codes which are decoded in one read cycle. The code is concatenated when the stop character of the first bar code and the start character of the second bar code is a "D ", these two"D "are not transmitted.



### CX CODE- CODABAR



INSERT DATA -ON




1881 k

\* The data can any alphanumerics of FULL ASCII Table (GROUP 34-42)(page 52-60)

#### **REMARK:**

The CX-Code consists of two bar Codes which are decoded in one read cycle, the code is concatenated when the stop character of the first bar code is a C, and the start character of the second bar code is a B. The B and C characters are not transmitted.

SYMBOLOGIES: ABC-CODABAR, CX- CODABAR



ABC- CODABAR





\* The data can any alphanumerics of FULL ASCII Table (GROUP 34-42)(page 52-60)

#### **REMARK:**

ABC-CODABAR (American Blood Commission.). The ABC Code is an acronym for American Blood Commission. This bar code is a variant of the CODABAR Code developed for he use in the blood bank. This Code consists of two bar codes which are decoded in one read cycle. The code is concatenated when the stop character of the first bar code and the start character of the second bar code is a "D ", these two"D "are not transmitted.



### CX CODE- CODABAR



INSERT DATA -ON



1881 k

\* The data can any alphanumerics of FULL ASCII Table (GROUP 34-42)(page 52-60)

#### **REMARK:**

The CX-Code consists of two bar Codes which are decoded in one read cycle, the code is concatenated when the stop character of the first bar code is a C, and the start character of the second bar code is a B. The B and C characters are not transmitted.

SYMBOLOGIES : CODABAR COUPLING, ADJACENT REQUIRED.



SET INSERT DATA\*

#### **CODABAR COUPLING**





ABC-Codabarand CX-Codabar have certain rules regarding the Stop Character of first bar code and the stop character of Second bar code while in conjunction, while Codabar-Coupling is enabled, the data from any two Codabar bar codes can be coupled into one set of data without any limitations between the Stop character of first bar code and the Start character of second bar code. The Start and Stop characters associated with each bar code each bar code will be sent. \*The data can any alphanumerics of FULL ASCII Table (GROUP 3442)(page 52-60)

### **ADJACENT REQUIRED**

If CODABAR ADJACENT is enabled, the scanner will only read two adjacent Codabar bar codes, A single bar code will not be read.



#### NOTES:

- Both ABC-Codabar and CX-Codabar can be enabled together, except when Codabar-Coupling is also enabled.
- If ABC-Codabar, CX-Codabar, and Codabar-Coupling are all enabled at same time, the scanner will read only Codabar-Coupling, that is, ABC-Codabar, CX-Codabar wil be considered coupling formats.

#### SETTING PROCEDURE - SET INSERT DATA

Step 1- Scan SET INSERT DATA.


- Step 2- Scan any combination of alphanumeric characters from FULL ASCII TABLE.
- Step 3- Scan SET INSERT DATA.



#### NOTES:

- 1. The scanner will beep three times as reminder that a setting is not yet complete.
- If you make a mistake, forget a step, etc., scan RESET to start again.

SYMBOLOGIES: STANDARD & FULL ASCII CODE 39,CODE 32

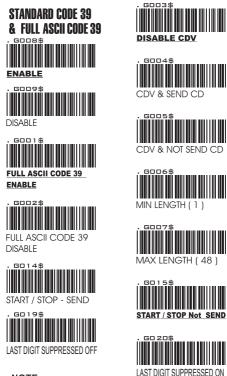

#### NOTE:

The default for Code 39 is Standard Code 39. If Full ASCII Code 39 is enabled, Standard Code 39 will be automatically disabled.







CODE 32








42

### **APPENDIX**

FULL ASCII (Code 39) NUMERIC TABLE

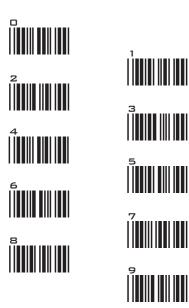

### SETTING PROCEDURE

#### **MIN / MAX LENGTH**

STEP 1 - Scan: MIN LENGTH/ MAX LENGTH STEP 2 - Scan : Two digits from Appendix . STEP 3 - Scan: MIN LENGTH / MAX LENGTH

Please note that when Min Length and / or Max Length are enabled, the scanner will only read bar codes that fall into those length parameters. Bar codes shorter or longer than specified will not be read. The default lengths for these are indicated in parentheses under the Min and Max bar codes for each symbology.

#### NOTES:

- 1. The scanner will beep three times as a reminder that a setting is not yet complete.
- 2. If you make a mistake, forget a step, etc., Scan RESET to start again.

43





SYMBOLOGIES: UPC-E SYSTEM NUMBER

### **UPC EO**





UPC E1

#### . ноб5\$ Шинин Шинин Шинин Е(1)ОN



#### NOTE:

Most UPC Bar codes lead with 0 number systems, For these bar codes use UPC E(0) Selection, For the bar codes that lead with the 1 number, use UPC(E1) select

UPC-E EXPAND To UPC-A






#### NOTE:

- 1. If UPC E EXPAND TO UPC A FORMAT set enabled, The output of UPC-A will be 12 digits.
- The default output of UPC-A is 12 digits, if UPC-A EXPAND TO EAN13 is enabled, a zero will be added to in front of the bar code.

SYMBOLOGIES FORMATTING: UPC-E

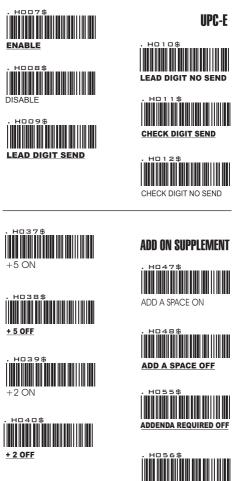

ADDENDA REQUIRED ON

#### NOTE:

When "addenda required on" is set, the scanner reads bar codes that have addenda only if one or both of "+2 / +5" is on.

SYMBOLOGIES FORMATTING: UPC -A



#### NOTE:

When "addenda reqaired on" is set, the scanner reads bar codes that have addenda only if one or both of "+2 / +5" is on.

46

SYMBOLOGIES FORMATTING: EAN 8



#### ADDENDA REQUIRED ON

#### NOTE:

When "addenda reqaired on" is set, the scanner reads bar codes that have addenda only if one or both of "+2 /+5" is on.

47



- 1. When "addenda required on" is set, the scanner reads bar codes that have addenda only if one or both of "+2 / +5" is on.
- Either ISBN or ISBN will be considered as an extension of EAN-13, If ISSN or ISBN need to be read, EAN13 must be enabled. If ISSN and ISBN need to be read with addenda, EAN13 must be enabled with ADDENDA REQUIRED set to ON.





**NOTE :** ISSN OI Both ISSN and ISBN are the extension codes of EAN-13, If scanner is required to read either ISSN or ISBN, Enable EAN-13 must be enabled. Otherwise the scanner will not able to read the ISSN or ISBN.

48





ISMN

SYMBOLOGIES: EAN/UCC-128, CODE 128, PDF417





#### NOTES : DEFINE EAN 128

The first FNC1 character is translated to ]c1, and the second FNC1 character is translated to an ASCII <GS> character ( scan from Group 43-45 ). (page61-63)

#### String format :

|C1 DATA CHARACTERS <GS> DATA CHARACTERS

#### Setting Procedure:

1:Scan DEFINE EAN128. 2: Scan ASCII Code (page60) 3: Scan DEFINE EAN128.





DISABLE

### **PDF417**



Enable



MIN LENGTH (5)




MAX LENGTH (48)



Disable

#### SYMBOLOGIES: EAN/UCC-128, CODE 128, PDF417

<Set PDF 417 Code Enable/Disable>

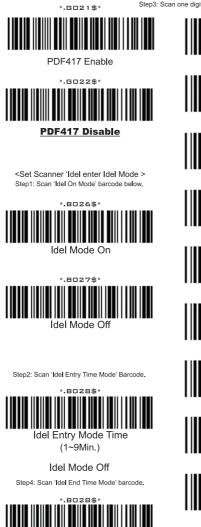

Idel End Mode Time

Step3: Scan one digit Idel time barcode as below.



#### DATABAR (RSS), LIMITED FOR CONTACT/PEN TYPE






#### Databar (RSS), LIMITED, EXPANDED



50-1

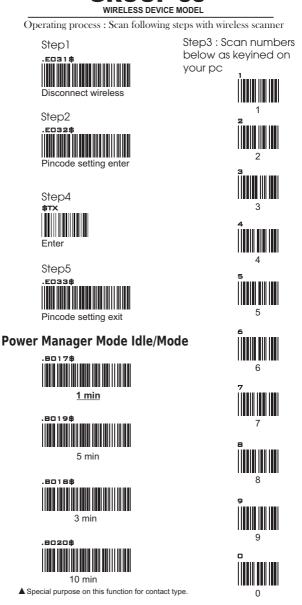

#### Note :

- 1. Temperature of charging environment should be in  $0^{\circ}C \sim 40^{\circ}C$ .
- 2. This unit of devicd uses one cradle with only one host.
- 3.Default idle mode is 1 min.
- 4.Concept of operating process on host device and wireless dougle, make sure wireless dougle operated in advance, then make host device to initiate.
- 5. When host device can't connect with wireless dongle, make host device do nothing 1 min(default) to enter idle mode, then trigger host device to connect with wireless dongle, especially after charged.

51

WIRELESS DEVICE MODEL

# Non-pincode wireless type [Scanner LED & Beeper Indication]

	Scanner LED & Beeper Indication							
scanner		Green LED	Red LED	Blue + Red LED	Beeper	Remark		
	initial / hand shacking	-	-	blink	long beep 1 time	-		
	finished connection	-	-	-	2 beep 1 time	-		
	Standby after connection	-	-	-	-	none any indication for saving power		
	not connected	-	-	blink	3 beep 1 time	-		
	scanning barcodes under not finished connection	-	-	-	error beep tone	-		
	successfully both had read barcode and transmitted	flash 1 time	-	-	beep 1 time	-		
	error in reading barcodes	-	-	-	-	only red scan light		
	low power	-	flash	-	short beep 5 times every 6 sec. till power exhaust electricity	-		

# GROUP-33 WIRELESS DEVICE MODEL

# Non-pincode wireless type [Scanner LED & Beeper Indication]

		Green LED	Red LED	Blue + Red LED	Beeper	Remark
	power off	-	-	-	-	scan barcode setting of 1 min. / 3 min. / 5 min. / 10 min.
	charging	flash	-	-	-	-
cradle	full charge	on	-	-	-	charge needs 4 hours from 0 to 100%

WIRELESS DEVICE MODEL

# Pincode wireless type [Scanner LED & Beeper Indication]


Scanner LED & Beeper Indication							
scanner		Green LED	Red LED	Orange LED	Beeper	Remark	
	initial / hand shacking	-	-	-	short beep 1 time	-	
	finished connection	flash	-	-	long beep 1 time	-	
	Standby after connection	-	-	-	-	-	
	scanning barcodes under not connection	flash 5 times	-	-	error beep tone	-	
	successfully both had read barcode and transmitted	flash 1 time	-	-	beep 1 time	-	
	error in reading barcodes	-	-	-	-	only red scan light	
	low power	flash	-	-	short beep 5 times every 6 sec. till power exhaust electricity	-	

# GROUP-33 WIRELESS DEVICE MODEL

# Pincode wireless type [Scanner LED & Beeper Indication]

		Green LED	Red LED	Orange LED	Beeper	Remark
	power off	-	-	-	-	scan barcode setting of 1 min. / 3 min. / 5 min. / 10 min.
cradle	Not charge	-	on	-	-	-
	charging	flash	on	-	-	-
	finish charge	-	-	on	-	charge needs 4 hours from 0 to 100%

FULL ASCII TABLE ( CODE 39 )

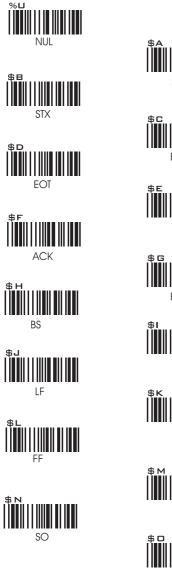



















FULL ASCII TABLE ( CODE 39 )

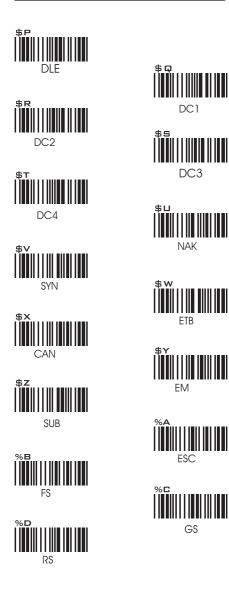

FULL ASCII TABLE ( CODE 39 )

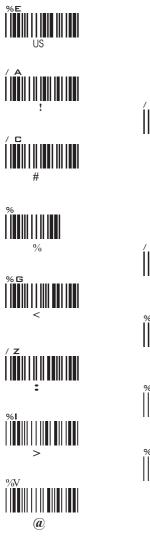

%F %Ј 

FULL ASCII TABLE ( CODE 39 )

D 

Α F

FULL ASCII TABLE ( CODE 39 )

G к z N Р R 

Н .1 0 S U

FULL ASCII TABLE ( CODE 39 )

× Х % N % W +B b 

Ŵ 

FULL ASCII TABLE ( CODE 39 )

е + G +κ + M 

+F h i + N +P +R

FULL ASCII TABLE ( CODE 39 )

Х +z 7 %R DFI


+ w % **Q** %P ł %5 



FULL ASCII NUMERIC TABLE (CODE 39)

**GROUP-42** 

FUNCTION CODE TABLE ( CODE 39 )

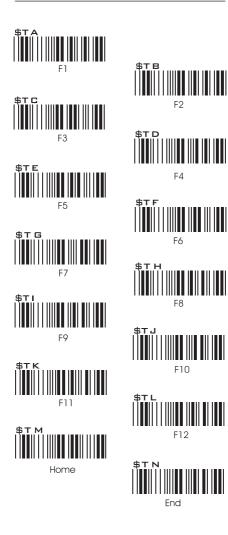

FUNCTION CODE TABLE (CODE 39)









Esc

\$T W

\$TY


















FUNCTION CODE TABLE (CODE 39)

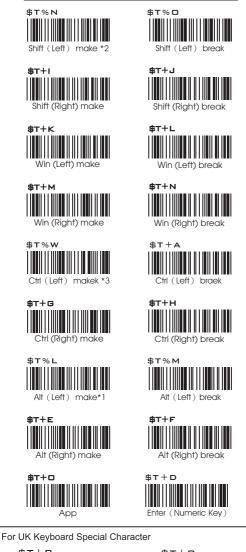





### Note:

\*1. "Alt(left)Make" is programmed, please scan "Alt(left)Break" to resume barcode setting. \*2. "Shift(left)Make" is programmed, please scan "Shift(left)Break" to resume barcode setting. \*3. "Ctrl(left)Make" is programmed, please scan "Ctrl(left)Break" to resume barcode setting.



The Ezscan is simple to install and use. Most operational problems can be attributed to:



#### INCORRECT INTERFACE CONNECTION INCORRECT CONFIGURATION SETUP POOR BAR CODE QUALITY

### **GENERAL PROCEDURES**

- 1. First, make sure the scanner is firmly connected to the host computer, when attached correctly, the scanner will emit one long beep. When the trigger is pressed, LED will flash.
- 2. Once the power is on, try scanning some sample bar codes from this user's guide. The scanner should beep and the LED should flash to indicate a good read in the default configuration. If reading the bar code does not result in a good read, there may have been a problem with the scanning technique or the interface configuration setting. Reset the scanner to default.
- 3. If the scanner indicates a good read, but no output of data to the monitor, please check the cabling connect

#### KEYBOARD INTERFACES PROBLEMS.

In general, the Keyboard Wedge interface is trouble free, but there still are some things to check in the event of a problem.

#### Do you have the correct cable?

Most computers use an XT/AT-compatible keyboard. Be sure you have the proper cable for your computer.

#### Does the keyboard work?

Since the keyed-in data from keyboard must pass through the decoder, the cabling connections are correct if the keyboard is functioning.

#### Can your computer accept the data fast enough?

Your computer's BIOS has a feature related to keyboard typing speed. Try to set the Intercharacter Delay feature to stimulate the keystroke entry speed.

#### Does keyboard port supply enough power ?

Most notebook computers do not supply enough power to the scanner. The symptom of insufficient power is a lower "good read" rate (since there is not enough power to properly support the scanning operation).



**GROUP-47** TROUBLE SHOOTING

#### **RS232INTERFACE PROBLEMS**

### Once you read bar code, there is no output on the monitor: the symptoms may be caused by:

- If the handshaking Have you set the protocol of RS232 like Baud rate, data bits, parity and handshaking etc. of a scanner to match to the PC terminal setting? Solution: reset the above mentioned RS232 protocol of scanner to match to PC protocol.
- 2. Pls check if the cable pinout assignment of bar code match to the pinout assignment of PC terminal?

#### No power supply to scanner;

- 1. Do you connect the right power adaptor to the scanner?
- 2. Does scanner connect the cable with right pinout which match to PC-terminal?

#### **INTERFACE PROBLEMS**

#### Are you using the Wand Emulation mode with Code 39 output? If so, is your decoder set to accept Code 39 data?

Check the scanner's configuration setting to make sure it can accept the bar code symbology you are trying to read.

### Although the cable seems to connect properly, does the scanner not send data to the host computer?

There are no industrial standards for scanner interface cables, so even if they look alike and have similar connector, they might not be alike. For example, cables for Keyboard Wedge and Wand Emulation are similar, but they are not interchangeable due to different pin assignments. Be sure the cable you are using attaches correctly to the matching connector.

#### **CONFIGURATION SETUP**

#### Are you setup for the right Interface?

Are you set up for the right interface? Did you select the Keyboard Wedge cable but set the scanner for RS-232 or Wand Emulation? Or did you change the Keyboard cable to RS-232 but forget to set the scanner interface to RS-232 as well? Set the scanner to its default settings, then selectthe correct interface based upon the cable and input you are using.

Sympton ----The LED lighting is stuck, and no function at all, even triggered the scanner.

Solution ---- Set the Scanner to Default condition, and choose the right interfaces



#### Is the proper symbology enabled?

Each bar code symbology can be individually enabled or disabled. It is suggested that you enable only those that you will be scanning, thereby eliminating the possibility of mis reads from the scanning of other symbologies.

### Does the selected the bar code symbology configuration match the bar code(s) being read?

Scanned data from each bar code symbology can be restricted eliminate the scanning of unused symbologies. The restrictions individually set for each symbology.

#### POOR BAR CODE QUALITY

The third problem area has nothing to do with the scanner, but rather the printed quality of the bar code and/or the scanning technique employed.

#### TOLERANCE OF BAR CODE

A bar code may have a tolerance. Normally, the tolerances are caused by bar code font software or a printer. Software with a proven reputation should be chosen to generate bar codes. If the printed bar codes are distorted, the scanner might not recognize them.

It is very difficult to get a good read from a poor quality bar code unless it is scanned many times. As the quality of the symbology drops, the chances for undetected error increase. A bar code Check Digit Verification (CDV) should be used to check the quality of the suspect bar codes.

#### LABELS ( PAPER & COLOR & PRINTER )

The light source of a bar code scanner is generally red, so there are some restrictions for the printing of labels. Care should be taken whenchoosing materials, especially color inks and papers. Sometimes the combination of the label color and the color of the ink can, in effect, blind the scanner. Media with a shiny surface will also cause reading difficulties for scanners.

Moreover, poor printing quality can also result in reading difficulties for the scanner. Bad printing may be caused by the type of printer used; dot matrix and inkjet printers will not produce high quality bar codes. Also check to make sure the ink, ribbon, or toner in good supply.

## **APPENDIX 1** DEFAULT TABLE 1

CROUP	PARAMETER	DEFAULT	
1	Computer Type	PC-AT	
1	Interfaces		
	Scan speed		
2	Reading Mode	Trigger	
	Beep Tone Mode 2.1k	Beep Medium	
3	Beep Tone Mode 2.7k	Beep Medium	
	Capital lock Mode	Caplock Off	
	Setup code read	Setup up code on	
4	Preamble & Postamble	OFF	
5	Accuracy Adjustment	2	
6~9	Enable & Disable Code ID	OFF	
10	Interblock Delay	0 ms	
10	Inter-character Delay	140us	
	Keyboard Layout	English(USA)	
11	Terminator	CR, CR+LF	
	numeric key		
	Baud Rate	9600	
12	Data Bits & Parity	8 Bit None	
	Stop Bits	1 stop bit	
	Handshaking	None	
13	ACK/NAK	OFF	
	Flow Control TimeOut	1 Sec	
	Level dutation of Mini Width	200us	
	Polarity Of Idle Condition	High	
14	Output of Wand Emulation	Bar High/Space Low	
	Wave Form	Full ASCII 39	
	Enable and Disable Symbologies	Tunnisen sy	
	Code 32	Disable	
	China Postal Code	Enable	
	UK Plessy Code	Disable	
	Industrial 2 of 5	Disable	
	Matrix 2 of 5	Disable	
	Interleaved 2 of 5		
		Enable	
	Code 128	Enable	
	Cadabar	Enable	
15~16	Telepen	Disable	
	UPC-A	Enable	
	UPC-E	Enable	
	EAN-8	Enable	
	EAN-13	Enable	
	MSI	Disable	
	Code 39	Enable	
	Code 11	Enable	
	Code 93	Disable	
	EAN-128	Enable	
	IATA	Disable	
	China Post Code		
	Enable/Disable	Enable	
1	Check Digits	Disable CDV	
17	Min Length	11 digits	
1/	Max Length	48 digits	
	MSI	·	
	Enable/Disable	Disable	
18 1			
10 1	Check Digits	CDV & send CD	

\* The interface setting of scanner does not have certain default value, the default of interface of scanner will be set according to customer order.

# **APPENDIX 1**

### DEFAULT TABLE 2

CRO	UP	PARAMETER	DEFAULT			
		UK Plesssy				
		Enable/Disable	Disable			
18	2	Enable/Disable	Disable			
		Check Digits	CDV & not send CD			
		IATA				
		Enable/ Disable	Disable			
	1	Check Digits	Disable CDV			
		Min Length Max Length	6 digits 48 digits			
	-	Code 93	40 ugits			
19	2	Enable/Disable	Disable			
	2	Min Length	6 digits			
		Max Length Telepen	48 digits			
	3	Enable/Disable	Disable			
	-	Telepen ASCII /Number	Number			
		Interlenved 2 of 5				
		Enable/Disable	Enable			
	1	Check Digits First/ last digit suppressed	Disable CDV No suppressed			
		Min Length	6 digits			
20		Max Length	48 digits			
		Code II				
		Enable/Disable	Disable			
	2	Check Digits Min Length	Disable CDV 6 digits			
		Max Length	48 digits			
	1	Industrial 2 of 5				
		Enable/Disable	Disable			
		Check Digits	Disable CDV			
		Min Length Max Length	6 digits 48 digits			
21		Matrix 2 of 5	46 ugus			
		Enable/Disable	Disable			
	2	Check Digits	Disable CDV			
		Min Length	6 digits			
		Max Length Codabar	48 digits			
		Enable/Disable	Enable			
		Check Digits	Disable CDV			
		Min Length	6 digits			
22	1	Max Length ST/SP;Abcd/abcd,abcd/tn*c,	48 digits			
			ABCD/ABCD			
		ABCD/ABCD,ABCD/TN*C Start(ST)/Stop(SP)send	Send			
		CLSI Format	ON			
		ABC-Codabar				
	1	ON/OFF	OFF			
23		Insert Data CX-Codabar	OFF			
	2	Insert Data	OFF			
	_	ON/OFF	OFF			
		Codabar-Coupling				
24		ON/OFF	OFF			
		Insert Data Adjacent Required	ON			
		Code 39	OFF			
		Full ASCII 39 Enable/Disable	Enable			
		Check Digits	Disable CDV			
		Start/Stop	Not Send			
25		Min Length Max Length	1 digits			
		Cobe 32	48 digits			
		Enable/Disable	Disable			
		Leading send/not send	send			
		Tailing send / Tailing not send	Tailing send			



# **APPENDIX 1**

### DEFAULT TABLE 3

CROU	CROUP PARAMETER		DEFAULT		
		UPC-E systems number			
		UPC E(0) On/Off	ON		
26		UPC E(1) On/Off	OFF		
		UPC-E expand to UPGA	Disable		
		UPC-E			
		Enable/Disable	Enable		
		Check Digits	Send		
27		Lead Digits	Send		
		Add a space	OFF		
		Addenda required	ON		
		+5 On/Off	OFF		
		+2 On/Off	OFF		
		UPC-A			
		Enable/Disable	Enable		
		Check Digits	Send		
28		Lead Digits	Send		
		Add a space	OFF		
		Addenda required	ON		
		+5 On/Off	OFF		
		+2 On/Off	OFF		
		EAN-8			
		Enable/Disable	Enable		
		Check Digits	Send		
29		Lead Digits	Send		
27		Add a space	OFF		
		Addenda required	ON		
		+5 On/Off	OFF		
		+2 On/Off	OFF		
		EAN-13			
		Enable/Disable	Enable		
		Check Digits	Send		
		Lead Digits	Send		
30		Add a space	OFF		
50		Addenda required	ON		
		+5 On/Off	OFF		
		+2 On/Off	OFF		
		ISSN On/Off	OFF		
		ISBN	OFF		
		EAN/UCC128			
	1	Enable/Disable	Enable		
	1	Code ID	Disable		
		Func I Chear send	Not Send		
31		Code 128			
		Enable/Disable	Enable		
	2	Check Digits	Disable CDV		
		Min Length	5 digits		
		Max Length	48 digits		
	3	PDF417	Disable		
		Rss-14	Disable		
		Rss-14 Check digit	Not Send		
		Rss-14 Prefix	Not Send		
22		Rss-14 Stacked	Enable		
32		Rss-Limited	Disable		
		Rss-Limited Check Digit	Not Send		
		Rss-Limited Prefix	Not Send		
		Rss-Expanded	Disable		
		1 1			


### **Cable Pin Assignment**

#### INTERFACES:

#### 1. TTL, Wand Emulation

1.1) AMP (D-Sub 9Pin):


Pin	Signal		
2	Data		
7	GND		
9	+5VCC		





1.2 ) Din 5 male (240 degree):


Pin	Signal
1	+5Vcc
2	Data
3	GND
4	N/A
5	N/A



### 2. Keyboard Interface:


Type of connector: 2.1 ) PS/2 Mini Din6 Female:

Pin	Signal
1	PC Data
2	NC
3	GND
4	+5Vcc
5	PC-Clk
6	NC



2.2) PS/2 Mini Din6 Male:

Pin	Signal
1	KB-Data
2	NC
3	GND
4	+5Vcc
5	KB-CLK
6	NC




### **Cable Pin Assignment**


#### Type of connector:

2.3) PC-AT : Din 5 Male :

Pin	Signal
1	KB-Clk
2	KB-Data
3	NC
4	GND
5	+5VCC




2.4) PC-AT : Din 5 Female



#### 3.RS232 Interfaces:

#### 3.1) DB9F

Pin	Signal
2	TXD(Out)
3	RXD(In)
5	GND
7	CTS(In)
8	RTS(Out)
9	+5Vcc





#### 3.2) DB25F

Pin	Signal
2	RXD(In)
3	TXD (out)
4	CTS(In)
5	RTS (Out)
7	GND
16	+5VCC
25	+5VCC

#### 4.USB.Interface:

Pin	Signal
1	+5VCC
2	Data –
3	Data+
4	GND

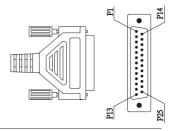



## BAR CODE TEST CHART

DENSITY	NARROW	WIDE	CHAR.GAP	N/W
	mm(mil)	mm(mil)	mm(mil)	RATIO
MEDIUM DENSITY	0.25(10)	0.625(25)	0.25(10)	1/2.5

### **MEDIUM DENSITY**

NW-7 (CODABAR)





b-\$:/.+00123B

CODE-39 TEST

Interleaved 20f5

UPC

FAN



9876543210





## BAR CODE TEST CHART

DENSITY	NARROW	WIDE	CHAR.GAP	N/W
	mm(mil)	mm(mil)	mm(mil)	RATIO
MEDIUM DENSITY	0.25(10)	0.625(25)	0.25(10)	1/2.5

### LOW DENSITY



CODE-39 TEST



0012040070











#### PDF417 Demo Chart


LVx:The Database data source contains a list of variables created as and when you need them. These variables are fed by data from queries or ASCII tables.

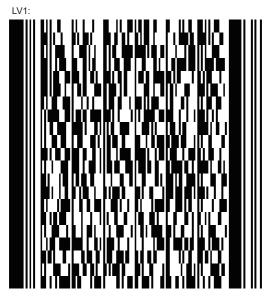


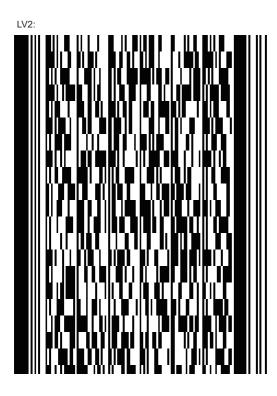


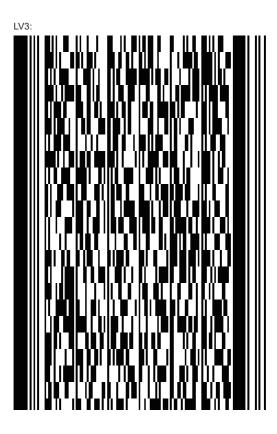


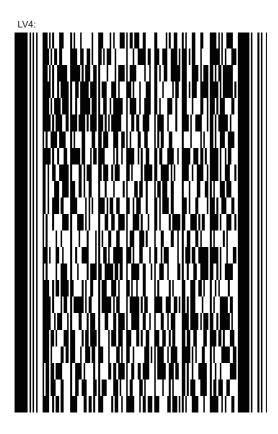

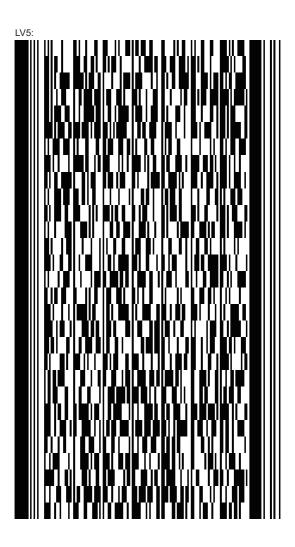

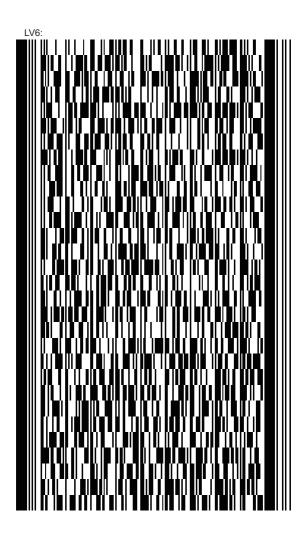

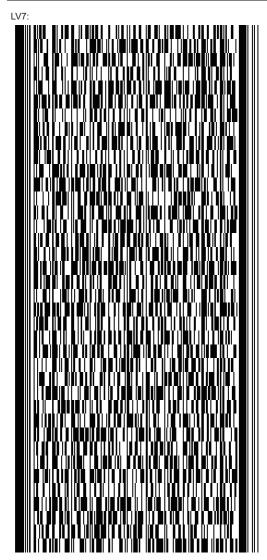

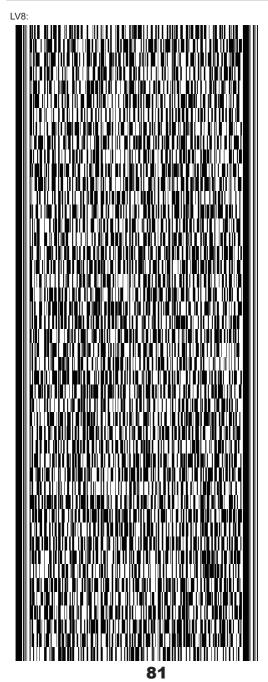

### Auto Sensing Mode for Laser scanner with Infrared Sensor



Auto Sensing mode (IR) Enable For Laser Scanner

Default :

- 1. Scanner is required to place on MT709-1 stand for work.
- 2. When a object arise in front of window of the scanner, the scanner will scan automatically.

Delay time mode, when there was no symbology decoding


.F030\$



Default 3 sec. Setting range 01~30 sec.

When scanning light arisen and there was no barcode decoded for 3 sec.(default), then turn off scanning light automatically.

E.g.. If you want set up "Delay time mode, when there was no symbology decoding" to 10 sec.

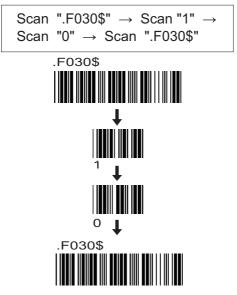

### Auto Sensing Mode for Laser scanner with Infrared Sensor


Delay time mode lingering on the same barcode



Default 30 sec. Setting range 03~60 sec.

After a barcode was decoded, the scanning light still linger on it for 30 sec.(default), then turn off scanning light automatically.

E.g.. If you want set up "Delay time mode lingering on the same barcode" to 10 sec.

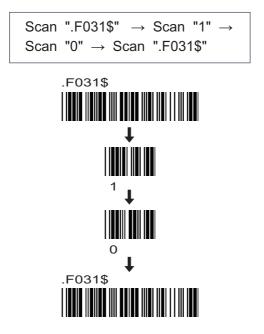

## **Appendix 5** Auto Sensing Mode for Laser scanner with Infrared Sensor

Use magnetic sensor for stand setting



\*The scanner is required place on MT709-1 stand to enable auto sensing mode. Once scanner remove from the MT709-1 stand, then the scanner change to be trigger mode.

(MT709-1 stand with magnetic)



\*Either place scanner on MT709-1 stand or remove scanner from MT709-1 stand, the scanner still is under auto sensing mode.

Time setting codes





### Auto Sensing Mode for CCD scanner with Infrared Sensor



Auto Sensing mode (IR) Enable For CCD Scanner

#### Default :

- 1. Scanner is required to place on MT709-1 stand for work.
- 2. When Autosensing mode is on, both Green LED and Magnetic switches will be on automatically.
  - (Green LED ON +Magnetic switch ON).
- 3. When similar symbologies arise in front of window of the scanner, the scanner will scan automatically.

Delay time mode, when there was no symbology decoding




Default 3 sec.

Setting range 01~30 sec.

When scanning light arisen and there was no barcode decoded for 3 sec.(default), then turn off scanning light automatically.

E.g.. If you want set up "Delay time mode, when there was no symbology decoding" to 10 sec.

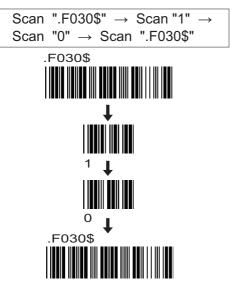

### Auto Sensing Mode for CCD scanner with Infrared Sensor

Use magnetic sensor for stand setting



Stand with magnetic enable

\*The scanner is required place on MT709-1 stand to enable auto sensing mode. Once scanner remove from the MT709-1 stand, then the scanner change to be trigger mode.

(MT709-1 stand with magnetic)



Stand without magnetic disable

\*Either place scanner on MT709-1 stand or remove scanner from MT709-1 stand, the scanner still is under auto sensing mode.

### Auto Sensing Mode for CCD scanner with Infrared Sensor

Green LED illumination light ON:



Green LED on



Green LED off

Green LED light is enhanced the sensitivity of Autosensing mode. If Green LED is on, the sensitivity of Autosensing will be more sensitive.

### Time setting codes



